

QUARANTINE NOTICE

Reference number:	QN-03-1973	Issued: 18 September, 2024
Subject:	Oil Cooler Hoses	
Model(s):	DBX707, Vantage and DB12	
VIN range:	Refer to the separately published list of VINs (Vehicle Identification Numbers)	
Applicable to:	All Dealers	
Distribute to:	Head of Business After Sales Manager Service Manager Sales Manager	Warranty Staff Technician(s) Parts Staff

Reason for this Quarantine Notice

Aston Martin has determined that a defect which relates to motor vehicle safety may exist on a number of DBX707, DB12 and Vantage vehicles built between October 2022 and July 2024.

On affected vehicles, certain oil hoses for the oil cooler may be prone to split with a resulting loss of oil and oil pressure. Sudden and rapid loss of oil and oil pressure could lead to the engine stalling or seizing which could increase the risk of crash or fire (in the presence of an ignition source). During failure, the oil level and pressure warnings may be displayed in the instrument cluster. After failing, the driver may see smoke from the engine area.

On the affected vehicles it is necessary to replace the oil cooler hoses.

PLEASE DO A CHECK OF ALL VEHICLES THAT ARE IN THE AFFECTED VIN LIST
--

Workshop Procedure

DBX707

Replace the oil cooler hoses set (refer to Workshop Manual Procedure 03.03.DH).

DB12 and Vantage

Replace the oil cooler hoses set (refer to Workshop Manual Procedure 03.02.GM).

Part Data

Note: An initial stock of oil cooler hoses will be allocated to your Dealership automatically based on your vehicle inventory. They will be sent to you directly from the Aston Martin Parts Distribution Centre (PDC) within 48 hours of the publication of this document. Additional stock can be ordered for the repair of customer units.

Description	Part Number	Quantity
DBX707		
Hose Assembly- Oil Cooler Outlet	PY83-6B748-CC	1
Hose Assembly- Oil Cooler Inlet	PY83-6B747-CC	1
DB12 and Vantage		
Hose Assembly- Oil Cooler Outlet	RY63-6B748-AB	1
Hose Assembly- Oil Cooler Inlet	RY63-6B747-AB	1

Warranty Data

Procedure and Labour Time

Description	Labour Time	ROT Code
Replace oil cooler hoses DBX707	1.7 hours	03.03.DH
Replace oil cooler hoses Vantage	3.3 hours	03.02.GM
Replace oil cooler hoses DB12	2.55 hours	03.02.GM

To contact Aston Martin for further information about this document, please refer to the "Contact Us" page in Technical Hub.